

Diagnosis report of 2015 SUBARU FORESTER Exclusive



Car details

Color: Grey	CO ₂ NEDC Emission: 148 g/km
Fuel type: Diesel	
Body type: SUV	Gross Vehicle Weight (GVW): 2080 kg
Number of doors: 5	Engine size: 2.00 l
Number of seats: 5	Cylinders: 4
Mileage: 204 263 km	Power: 108 kw
VIN Code: JF1SJDLZ3FG212143	Fuel consumption: 5.90 l/100km
Gearbox: Manual	Tire size: 225/60 - 17"
Drive type: All-Wheel Drive	Longo Stock ID: G277068
Longo Certified	

Car photos



Disclaimer

This report has been generated automatically using the information available in our systems and may not be fully comprehensive or complete. Automated translation technology was used in its preparation, and as a result, minor inaccuracies may occur. If you have any questions or if any part of the report is unclear, please do not hesitate to contact our sales team. They will be happy to assist you.

Diagnosis report of 2015 SUBARU FORESTER Exclusive



Diagnosis details

Mileage on completion date: 204 263 km
Checked by Longo Shared Service certified diagnostics team: Arnas S., Eimantas A., Mindaugas G.

This vehicle has been inspected in accordance with the Longo 150-point checklist, covering the body exterior, interior, and mechanical condition. Based on the inspection performed and the information available at the time of assessment, no indications of involvement in major accidents were identified. Information regarding maintenance history and mandatory roadworthiness inspections is based on available documentation and records from the country of export. Please note that certain general wear and tear issues are considered acceptable and may not be repaired.

Summary of diagnosed issues

During the comprehensive diagnosis conducted by Longo, 24 issues were identified in the vehicle.

Interior	Exterior	Mechanical
✔ 4 issues identified	✔ 14 issues identified	✔ 6 issues identified

Diagnosis process



Interior

- ✔ 1. Front: Steering Wheel - Condition



✓ **2. Front:** Trims - Condition



✓ **3. Front:** Window Wash System - Functioning (Front and Rear)



✓ **4. Operation:** Roof Items - Electronic Opening and Condition



Exterior

✓ 1. Side: Left and Right Side - Visual Damage and Scratches



✓ 2. Other: Additional Polishing Tasks



✓ 3. Other: Additional Polishing Tasks

✓ 4. Other: Audible Signs (Loose Parts, Rattling, Etc.)



✔ **5. Front:** Front Bumper - Condition and Alignment



✔ **6. Front:** Front Bumper - Condition and Alignment



✔ **7. Front:** Front Bumper - Condition and Alignment



✓ **8. Front:** Hood - Visual Damage



✓ **9. Front:** Windscreen Integrity - Free from MOT-Excluding Damage



✓ **10. Front:** Window Washer Fluid Level (In Winter Also Winter-Adequate Fluid)



✓ **11. Rear:** Rear Bumper - Condition and Alignment




✓ **12. Rear:** Trunk - Visual Damage



✓ **13. Lights:** Light Bulbs



✓ **14. Lights:** Rear Lights (Brake, Fog, Indicator) - Basic Functioning, Damage, and Color

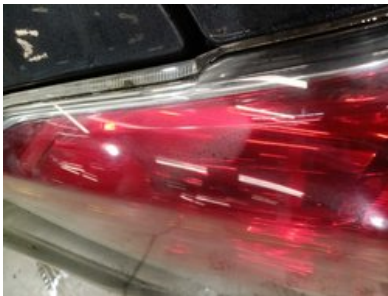

Mechanical

✓ 1. OTHER: Engine Oil & Filter Change



✓ 2. OTHER: Charge Battery

✓ 3. BRAKES: Front Brake Discs Both



✓ 4. SUSPENSION: Suspension Lower Arm Both



✓ **5. SUSPENSION:** Anti-Roll Bar




✓ **6. SUSPENSION:** Suspension Upper Arm



Other

✓ 1. Diagnostic Photo

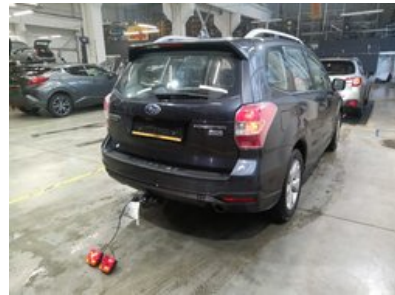

✓ 2. Brake Test Line Results



✓ 3. Air-Conditioning Measurement



✓ 4. Add Photo of Front Interior



Preparation and repair report of 2015 SUBARU FORESTER Exclusive



Summary of work performed in Longo Preparation center

During the preparation process, the following works were performed

Body & Interior

- ✓ 1. Change Element in Front Panel
- ✓ 2. Reservoir
- ✓ 3. Fender
- ✓ 4. Headlamp Alignment

Mechanical repairs

- ✓ 1. Charge Battery
- ✓ 2. Change Bulb for License Plate Lights
- ✓ 3. Engine Oil & Filter Change
- ✓ 4. Suspension Upper Arm
- ✓ 5. Anti-Roll Bar

Paintshop

- ✓ 1. Headlight Washer
- ✓ 2. Paint Front Bumper
- ✓ 3. Paint Boot
- ✓ 4. Replace Front Tow Hook (Paintshop)
- ✓ 5. Paint Front Fender

Cleaning & polishing

- ✓ 1. Body wet wash
- ✓ 2. Full interior deep clean using only hypoallergenic cleaning products
- ✓ 3. Post cleaning body polish

Spare parts used during preparation

- 1. Total Ineo First 0W30 208L 5.9L
- 2. Anti-Roll Bar Link (J77004YMT)
- 3. Oil Filter (H411W)
- 4. Oil Drain Gasket (EL705050)
- 5. Track Control Arm Left (TC4527)
- 6. Track Control Arm Right (TC4526)
- 7. Tow Hook Cover (PSB99006CA)
- 8. Dashboard Lower Bottom Trim Panel (SID9122)
- 9. Fender Forester SJ Left (PSB10033AL)
- 10. Window Washer Fluid Tank (PSBB2002A)

Disclaimer

This report has been generated automatically using the information available in our systems and may not be fully comprehensive or complete. Automated translation technology was used in its preparation, and as a result, minor inaccuracies may occur. If you have any questions or if any part of the report is unclear, please do not hesitate to contact our sales team. They will be happy to assist you.

Additional information about **2015 SUBARU FORESTER Exclusive**



Additional pictures















Ölservice

Hiermit wird bestätigt, dass die in der jeweiligen Inspektionsarbeiten Zulassungsdatum (das jeweils frühestmögliche Datum) in einem Zeitraum von vier Wochen vor oder nach Erreichen der Frist bzw. 500 km vor oder 500 km nach dem fälligen Kilometerstand durchgeführt wurden.

Fahrgestell-Nr.: _____

Wartungsplan	Übergabe
Datum der Wartung	Datum: 25.05.2016
km-Stand	km-Stand: 9182

TESTBERICHT

AUTOHAUS SCHLICH
PUDERBACH
56305
HÄNDLER-NR.: 451900
25.05.2016
9182

WARTUNGSMODUS

BATTERIE GUT

NACH DEM LADEN

Stempel: 12.07.11
12A CCB
00105103

Stempel: 12.07.11
12A CCB
00105103

Stempel: 12.07.11
12A CCB
00105103

Stempel: 12.07.11
12A CCB
00105103

Name des ausführenden SUBARU-Vertragspartners/der ausführenden Werkstatt: Autohaus Schlich
Urbacher Str. 27
56305 Puderbach
Tel: 02684-979156
Händl.Nr.: 451900

Unterschrift: _____

Unterschrift: _____

Unterschrift: _____

Unterschrift: _____

Die jeweiligen zutreffenden Arbeitsumfänge sind vollständig durchzuführen!

15

Ölservice mit Sicherheitstest / Inspektionsnachweis

Hiermit wird bestätigt, dass die in diesem Garantie- und Kundendienst angebotenen Wartungen durchgeführt wurden. Die jeweiligen Inspektionsarbeiten und der Ölservice mit Sicherheitstest sind im entsprechenden Jahr nach Übergabe der Zulassungsdatum (das jeweils frühestmögliche Datum) in einem Zeitraum von vier Wochen vor oder nach Erreichen der Frist bzw. 500 km vor oder 500 km nach dem fälligen Kilometerstand durchgeführt wurden.

Erstzulassungsdatum: _____

Fahrgestell-Nr.: _____

Wartungsplan	Inspektion nach 4. Jahr oder 60.000 km	Ölservice mit Sicherheitstest nach 5. Jahr oder 75.000 km	Inspektion nach 6. Jahr oder 90.000 km	Ölservice mit Sicherheitstest nach 7. Jahr oder 105.000 km
Datum der Wartung	Datum: 15.11.15	Datum: 26.06.18	Datum: 15.11.15	Datum: 15.11.15
km-Stand	km-Stand: 6067	km-Stand: 75431	km-Stand: 91797	km-Stand: 105103
Mobilitätsschutzbrief bis max. 15 Jahre	Neuwagen-Mobilitätsschutz - 5 Jahre -	Nr.: _____	Nr.: _____	Nr.: _____
Name des ausführenden SUBARU-Vertragspartners/der ausführenden Werkstatt: Autohaus Schlich Urbacher Str. 27 56305 Puderbach Tel: 02684-979156 Händl.Nr.: 451900	Stempel: SUBARU Autohaus Schlich Urbacher Str. 27 56305 Puderbach Tel: 02684-979156 Händl.Nr.: 451900	Stempel: SUBARU Autohaus Schlich Urbacher Str. 27 56305 Puderbach Tel: 02684-979156 Händl.Nr.: 451900	Stempel: SUBARU Autohaus Schlich Urbacher Str. 27 56305 Puderbach Tel: 02684-979156 Händl.Nr.: 451900	Stempel: SUBARU Autohaus Schlich Urbacher Str. 27 56305 Puderbach Tel: 02684-979156 Händl.Nr.: 451900
Unterschrift: _____	Unterschrift: _____	Unterschrift: _____	Unterschrift: _____	Unterschrift: _____

Die jeweiligen zutreffenden Arbeitsumfänge sind vollständig durchzuführen!

16

Ölservice mit Sicherheitstest / Inspektionsnachweis

hiermit wird bestätigt, dass die in diesem Garantie- und Kundendienstheft angegebenen Wartungen durchgeführt wurden.
Die jeweiligen Inspektionsarbeiten und der Ölservice mit Sicherheitstest sind im entsprechenden Jahr nach Übergabe-, Inbetriebnahme- oder Zulassungsdatum (das jeweils früheste Datum ist dabei gültig) oder beim Erreichen der angegebenen Kilometerstände (je nachdem was zuerst eintritt) in einem Zeitraum von vier Wochen vor oder nach Erreichen der Frist bzw. 500 km vor oder 500 km nach dem fälligen Kilometerstand durchzuführen.

Fahrgestell-Nr.: _____ Erstzulassungsdatum: _____

Wartungsplan	Inspektion nach 8. Jahr oder 120.000 km	Ölservice mit Sicherheitstest nach 8. Jahr oder 135.000 km	Inspektion nach 10. Jahr oder 150.000 km	Ölservice mit Sicherheitstest nach 11. Jahr oder 165.000 km
Datum der Wartung	Datum: <u>31.1.20</u> ☒ Auftrag zum vollständigen Wartungsdienst / Inspektion wurde vom Kunden erteilt ☐ teilweise erteilt ☐ Systemdiagnose mit dem Select Monitor durchgeführt	Datum: <u>15.1.21</u> ☒ Auftrag zum vollständigen Wartungsdienst / Inspektion wurde vom Kunden erteilt ☐ teilweise erteilt	Datum: <u>15.11.2021</u> ☐ Auftrag zum vollständigen Wartungsdienst / Inspektion wurde vom Kunden erteilt ☐ teilweise erteilt ☐ Systemdiagnose mit dem Select Monitor durchgeführt	Datum: _____ ☐ Auftrag zum vollständigen Wartungsdienst / Inspektion wurde vom Kunden erteilt ☐ teilweise erteilt
km-Stand	km-Stand: <u>121.605</u>	km-Stand: <u>137.578</u>	km-Stand: <u>143.855</u>	km-Stand: _____
Mobilitäts-schutzbrief bis max. 15 Jahre	Nr.: _____	Nr.: _____	Nr.: _____	Nr.: _____
Name des ausführenden SUBARU-Vertragspartners/der ausführenden Werkstatt	Stempel SUBARU Autohaus Schlich Urbacher Str. 27 56305 Puderbach Tel: 02684-979156 Hbf. Nr.: 451900	Stempel SUBARU Autohaus Schlich Urbacher Str. 27 56305 Puderbach Tel: 02684-979156 Hbf. Nr.: 451900	Stempel Karl Farrenberg GmbH Kölner Straße 100 57610 Altenkirchen Tel.: 02681-67990 info@HFauto.de	Stempel _____
	Unterschrift: <u>[Signature]</u>	Unterschrift: <u>[Signature]</u>	Unterschrift: <u>[Signature]</u>	Unterschrift: _____

17





Longo 150-point checklist

Every vehicle is carefully examined according to Longo's comprehensive 150-point checklist, ensuring a thorough assessment mechanical condition. Depending on the factors such as condition, mileage, and specifications, additional checks may be included or omitted.



Vehicle Identity & History

Vehicle identification number (VIN) verified	Registration number confirmed	Mileage verified
Year of manufacture confirmed	First registration date confirmed	Service history checked
Last service date and mileage recorded	Next service due date recorded	Previous accident damage check performed
Manufacturer recall status checked	Vehicle documents verified	Number of keys checked

Exterior Condition

Front bumper inspected	Rear bumper inspected	Bonnet/hood inspected
Roof inspected	Left side panels inspected	Right side panels inspected
All doors inspected	Boot/trunk inspected	Fuel filler cover inspected
Tow bar (if fitted) inspected	Number plate condition confirmed	Paintwork overall checked
Rust or corrosion checked	Gaps between panels checked	Windscreen inspected
Rear window inspected	Side windows inspected	Sunroof/panoramic roof inspected

Interior Condition

Driver's seat condition checked	Passenger seats checked	Rear seats checked
Seat adjustment mechanisms tested	Seat heating/cooling tested (if fitted)	Seatbelts checked
Carpets inspected	Floor mats inspected	Headlining inspected
Interior trims inspected	Dashboard inspected	Door trims inspected
Armrest inspected	Parcel shelf inspected	Luggage area condition checked
Luggage area carpets checked	Luggage area lighting tested	Spare wheel / repair kit checked

Lights, Mirrors & Glass

Front headlights tested	High beam tested	Fog lights tested
Daytime running lights tested	Rear lights tested	Brake lights tested
Reverse lights tested	Indicators tested	Number plate lights tested
Side markers/reflex reflectors checked	Interior lights tested	Dashboard warning lights checked
Sun visors inspected	Interior mirror inspected	Exterior mirrors inspected
Electric mirror adjustment tested		

Comfort & Electronics

Air conditioning tested	Heating system tested	Ventilation system tested
Window heating tested (front/rear)	Power windows tested	Central locking tested
Remote key tested	Child lock tested	Infotainment screen tested
Radio tested	Navigation tested (if fitted)	Bluetooth connection tested
USB/12V sockets tested	Parking sensors tested	Rear view camera tested
Parking assistance systems tested	Cruise control tested	Steering wheel buttons tested
Horn tested	Electronic driver aids checked (lane assist, etc., if fitted)	

Safety Equipment

Airbags checked via system	Passenger airbag switch checked	ABS warning light checked
ESC/traction control checked	Tyre pressure monitoring system tested	Fire extinguisher/first aid kit present (if supplied)

Engine Bay & Fluids

Engine starts normally	Engine idles smoothly	Unusual engine noises checked
Engine mounts checked	Drive belts checked	Timing belt/chain condition checked
Battery condition tested	Battery charging tested	Alternator performance tested
Fluid leaks checked	Engine oil level checked	Engine oil quality checked
Coolant level checked	Coolant quality checked	Brake fluid level checked
Brake fluid quality tested	Power steering fluid level checked	Power steering fluid quality checked
Windscreen washer fluid filled	Fuel system checked for leaks	

Braking System

Front brake discs checked	Rear brake discs checked	Brake pads checked
Brake hoses checked	Brake lines checked	Parking brake tested
Brake pedal response tested	ABS function confirmed	

Steering & Suspension

Steering wheel alignment checked	Steering response tested	No excessive steering play confirmed
Power steering assistance tested	Front suspension inspected	Rear suspension inspected
Shock absorbers inspected	Springs inspected	Ball joints inspected
Wheel bearings checked		

Wheels & Tyres

Front tyres tread depth measured	Rear tyres tread depth measured	Tyre wear pattern checked
Tyre sidewalls inspected	Tyre pressures checked	Spare tyre condition checked
Alloy wheels checked for damage	Wheel nuts/bolts secure	Locking wheel nut present
Additional tyre set inspected (if included)		

Exhaust & Fuel System

Exhaust condition checked	Exhaust leaks checked	Catalytic converter present
Diesel particulate filter present (if fitted)	Fuel tank condition checked	Fuel lines inspected
Fuel filler cap tested		

Road Test & Driving Performance

Smooth acceleration confirmed	Smooth gear shifting confirmed	Clutch operation tested
Braking performance tested	Driving stability confirmed	