

Diagnosis report of 2015 NISSAN QASHQAI Tekna



Car details

Color: White	CO ₂ NEDC Emission: 119 g/km
Fuel type: Diesel	
Body type: SUV	Gross Vehicle Weight (GVW): 2005 kg
Number of doors: 4	Engine size: 1.60 l
Number of seats: 5	Cylinders: 4
Mileage: 180 200 km	Power: 96 kw
VIN Code: SJNFDAJ11U1322467	Fuel consumption: 4.60 l/100km
Gearbox: Automatic	Tire size: 215/60 - 17"
Drive type: Front-Wheel Drive	Longo Stock ID: N134393
 Longo Certified	

Car photos



Disclaimer

This report has been generated automatically using the information available in our systems and may not be fully comprehensive or complete. Automated translation technology was used in its preparation, and as a result, minor inaccuracies may occur. If you have any questions or if any part of the report is unclear, please do not hesitate to contact our sales team. They will be happy to assist you.

Diagnosis report of 2015 NISSAN QASHQAI Tekna



Diagnosis details

Mileage on completion date: 180 200 km

Checked by Longo Shared Service certified diagnostics team: Justinas K., Eimantas A., Arnas S.

This vehicle has been inspected in accordance with the Longo 150-point checklist, covering the body exterior, interior, and mechanical condition. Based on the inspection performed and the information available at the time of assessment, no indications of involvement in major accidents were identified. Information regarding maintenance history and mandatory roadworthiness inspections is based on available documentation and records from the country of export. Please note that certain general wear and tear issues are considered acceptable and may not be repaired.

Summary of diagnosed issues

During the comprehensive diagnosis conducted by Longo, 25 issues were identified in the vehicle.

Interior	Exterior	Mechanical
✔ 12 issues identified	✔ 6 issues identified	✔ 7 issues identified

Diagnosis process



Interior

- ✔ **1. Inside:** Accessories - Functioning and Condition



✓ **2. Inside:** Accessories - Functioning and Condition



✓ **3. Inside:** Accessories - Functioning and Condition



✓ **4. Inside:** Accessories - Functioning and Condition



✓ **5. Inside:** Accessories - Functioning and Condition



✓ **6. Inside:** Gear Shift Boot and Gear Shift Knob - Condition



✓ **7. Inside:** Trims - Condition



✓ **8. Inside:** Trims - Condition



✓ **9. Operation:** Roof Items - Electronic Opening and Condition



✓ **10. Seats:** All Seats - Condition



✓ **11. Front:** Window Wiper Rubber and Handle (Front and Rear) - Condition



✓ **12. Doors:** Door Rubber Seals



Exterior

✓ **1. Rear:** Rear Window Integrity



✓ **2. Rear:** Rear Bumper - Condition and Alignment



✓ **3. Lights:** Light Bulbs



✓ **4. Lights:** Front Lights (City, Regular, Full Headlight, Fog, Indicator) - Basic Functioning, Damage, and Color



✓ **5. Lights:** Rear Lights (Brake, Fog, Indicator) - Basic Functioning, Damage, and Color



✓ **6. Front:** Hood Sound Insulation - Condition



Mechanical

✓ **1. OTHER:** Charge Battery

✓ **2. OTHER:** Engine Oil & Filter Change


✓ **3. BRAKES:** Rear Brake Disc (Both)



✓ **4. BRAKES:** Front Brake Discs Both



✓ **5. ENGINE:** Glow Plugs with Relay

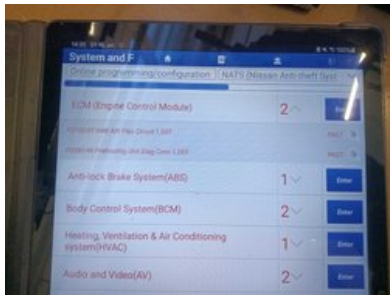

✓ **6. FINAL DRIVE, SHAFT & AXLES:** Driveshaft Joint Gaiter - Outer Right



✓ **7. SUSPENSION:** Ball Joints



Other

✓ 1. Brake Test Line Results

Quick order saved: Q00003394

Chassis test line					
Top Deviation	mm	0	2.55		
Difference	%	-	-		
Quality	%	-	-		
Efficiency	%	42	± 50		
Brake test					
Brake Force	N	2722	15 %	3190	2708
Braking Resistance	N	2750	-	2750	90
Quality	%	-	-		
Brake Force	N	-	-	1175	92 %
Brake Force	N	-	-		
Roll weight	kg	-	-		
Total weight designed / measured	kg	-	-		

Quick order saved: Q00003394

Chassis test line					
Top Deviation	mm	0	2.55		
Difference	%	0	± 21		
Roll grip	%	88	± 58		
Details test line					
Top Deviation	mm	0	2	55	52
Roll grip	%	84	2	85	5
Frequency	Hz	13	2 %	13	17
Roll weight	kg	1008			
Wheel weight	kg	152	100	200	200

✓ 2. Diagnostic Photo



✓ 3. Air-Conditioning Measurement



✓ 4. Add Photo of Front Interior



Preparation and repair report of 2015 NISSAN QASHQAI Tekna



Summary of work performed in Longo Preparation center

During the preparation process, the following works were performed

Body & Interior

- ✓ 1. Change Front Fog Lights
- ✓ 2. Change Rear Lights
- ✓ 3. Trunk Side
- ✓ 4. Change Sunroof (or Mechanism)
- ✓ 5. Headlamp Alignment

Mechanical repairs

- ✓ 1. Charge Battery
- ✓ 2. Change Bulb for License Plate Lights
- ✓ 3. Change Hood Sound Insulation
- ✓ 4. Change Rear Wiper (Mechanical)
- ✓ 5. Engine Oil & Filter Change
- ✓ 6. Driveshaft Joint Gaiter - Outer Right

Cleaning & polishing

- ✓ 1. Body wet wash
- ✓ 2. Full interior deep clean using only hypoallergenic cleaning products
- ✓ 3. Post cleaning body polish

Spare parts used during preparation

- 1. Engine Oil 6.2L
- 2. Oil Filter (OE666/5)
- 3. Hood Insulator Nissan Qashqai (658404EA0A)
- 4. Oil Drain Plug (101250)
- 5. Fog Lights Nissan (VAL043403)
- 6. Rear Light (ZDS191308KR)
- 7. Rear Wiper (SWF116520)
- 8. Drive Shaft Cover (0.025591)
- 9. Panoramic Curtain (VSA1122)

Disclaimer

This report has been generated automatically using the information available in our systems and may not be fully comprehensive or complete. Automated translation technology was used in its preparation, and as a result, minor inaccuracies may occur. If you have any questions or if any part of the report is unclear, please do not hesitate to contact our sales team. They will be happy to assist you.

Longo 150-point checklist

Every vehicle is carefully examined according to Longo's comprehensive 150-point checklist, ensuring a thorough assessment mechanical condition. Depending on the factors such as condition, mileage, and specifications, additional checks may be included or omitted.



Vehicle Identity & History

Vehicle identification number (VIN) verified	Registration number confirmed	Mileage verified
Year of manufacture confirmed	First registration date confirmed	Service history checked
Last service date and mileage recorded	Next service due date recorded	Previous accident damage check performed
Manufacturer recall status checked	Vehicle documents verified	Number of keys checked

Exterior Condition

Front bumper inspected	Rear bumper inspected	Bonnet/hood inspected
Roof inspected	Left side panels inspected	Right side panels inspected
All doors inspected	Boot/trunk inspected	Fuel filler cover inspected
Tow bar (if fitted) inspected	Number plate condition confirmed	Paintwork overall checked
Rust or corrosion checked	Gaps between panels checked	Windscreen inspected
Rear window inspected	Side windows inspected	Sunroof/panoramic roof inspected

Interior Condition

Driver's seat condition checked	Passenger seats checked	Rear seats checked
Seat adjustment mechanisms tested	Seat heating/cooling tested (if fitted)	Seatbelts checked
Carpets inspected	Floor mats inspected	Headlining inspected
Interior trims inspected	Dashboard inspected	Door trims inspected
Armrest inspected	Parcel shelf inspected	Luggage area condition checked
Luggage area carpets checked	Luggage area lighting tested	Spare wheel / repair kit checked

Lights, Mirrors & Glass

Front headlights tested	High beam tested	Fog lights tested
Daytime running lights tested	Rear lights tested	Brake lights tested
Reverse lights tested	Indicators tested	Number plate lights tested
Side markers/reflex reflectors checked	Interior lights tested	Dashboard warning lights checked
Sun visors inspected	Interior mirror inspected	Exterior mirrors inspected
Electric mirror adjustment tested		

Comfort & Electronics

Air conditioning tested	Heating system tested	Ventilation system tested
Window heating tested (front/rear)	Power windows tested	Central locking tested
Remote key tested	Child lock tested	Infotainment screen tested
Radio tested	Navigation tested (if fitted)	Bluetooth connection tested
USB/12V sockets tested	Parking sensors tested	Rear view camera tested
Parking assistance systems tested	Cruise control tested	Steering wheel buttons tested
Horn tested	Electronic driver aids checked (lane assist, etc., if fitted)	

Safety Equipment

Airbags checked via system	Passenger airbag switch checked	ABS warning light checked
ESC/traction control checked	Tyre pressure monitoring system tested	Fire extinguisher/first aid kit present (if supplied)

Engine Bay & Fluids

Engine starts normally	Engine idles smoothly	Unusual engine noises checked
Engine mounts checked	Drive belts checked	Timing belt/chain condition checked
Battery condition tested	Battery charging tested	Alternator performance tested
Fluid leaks checked	Engine oil level checked	Engine oil quality checked
Coolant level checked	Coolant quality checked	Brake fluid level checked
Brake fluid quality tested	Power steering fluid level checked	Power steering fluid quality checked
Windscreen washer fluid filled	Fuel system checked for leaks	

Braking System

Front brake discs checked	Rear brake discs checked	Brake pads checked
Brake hoses checked	Brake lines checked	Parking brake tested
Brake pedal response tested	ABS function confirmed	

Steering & Suspension

Steering wheel alignment checked	Steering response tested	No excessive steering play confirmed
Power steering assistance tested	Front suspension inspected	Rear suspension inspected
Shock absorbers inspected	Springs inspected	Ball joints inspected
Wheel bearings checked		

Wheels & Tyres

Front tyres tread depth measured	Rear tyres tread depth measured	Tyre wear pattern checked
Tyre sidewalls inspected	Tyre pressures checked	Spare tyre condition checked
Alloy wheels checked for damage	Wheel nuts/bolts secure	Locking wheel nut present
Additional tyre set inspected (if included)		

Exhaust & Fuel System

Exhaust condition checked	Exhaust leaks checked	Catalytic converter present
Diesel particulate filter present (if fitted)	Fuel tank condition checked	Fuel lines inspected
Fuel filler cap tested		

Road Test & Driving Performance

Smooth acceleration confirmed	Smooth gear shifting confirmed	Clutch operation tested
Braking performance tested	Driving stability confirmed	