Diagnosis report of
2021 SUBARU FORESTER Comfort

Car details

Color: Grey	CO_2 NEDC Emission: 154 g/km
Fuel type: Petrol / Hybrid	CO_2 WLTP Emission: 185 g/km
Body type: SUV	Gross Vehicle Weight (GVW): 2160 kg
Number of doors: 5	Engine size: 2.00 l
Number of seats: 5	Cylinders: 4
Mileage: 148 488 km	Power: 110 kw
VIN Code: JF1SKELL5MG118627	Fuel consumption: 6.70 l/100km
Gearbox: Automatic	Tire size: 225/60 - 17"
Drive type: All-Wheel Drive	Longo Stock ID: L217676
Longo Certified	

Car photos



Disclaimer

This report has been generated automatically using the information available in our systems and may not be fully comprehensive or complete. Automated translation technology was used in its preparation, and as a result, minor inaccuracies may occur. If you have any questions or if any part of the report is unclear, please do not hesitate to contact our sales team. They will be happy to assist you.

Diagnosis report of
2021 SUBARU FORESTER Comfort

Diagnosis details

Mileage on completion date: 148 488 km

Checked by Longo Shared Service certified diagnostics team: Arnas S., Eimantas A., Mindaugas G.

This vehicle has been inspected in accordance with the Longo 150-point checklist, covering the body exterior, interior, and mechanical condition. Based on the inspection performed and the information available at the time of assessment, no indications of involvement in major accidents were identified. Information regarding maintenance history and mandatory roadworthiness inspections is based on available documentation and records from the country of export. Please note that certain general wear and tear issues are considered acceptable and may not be repaired.

Summary of diagnosed issues

During the comprehensive diagnosis conducted by Longo, 6 issues were identified in the vehicle.

Interior	Exterior	Mechanical
No issues found	3 issues identified	3 issues identified


Diagnosis process











OBD II diagnosis

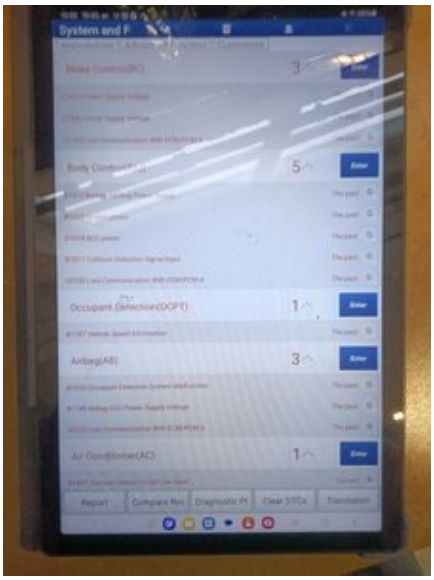

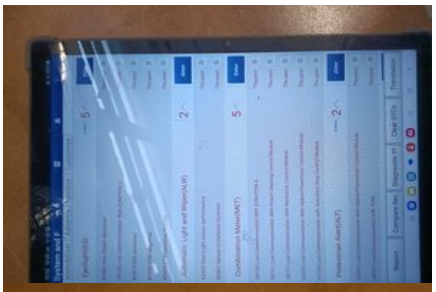

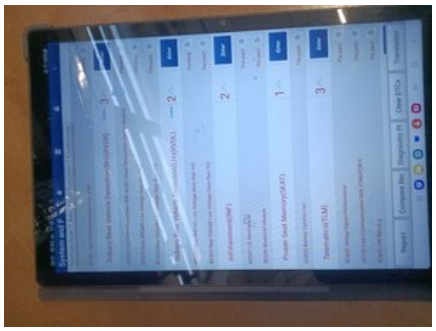

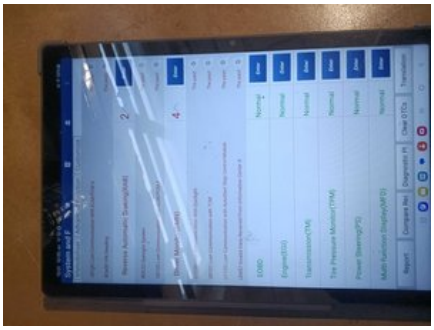

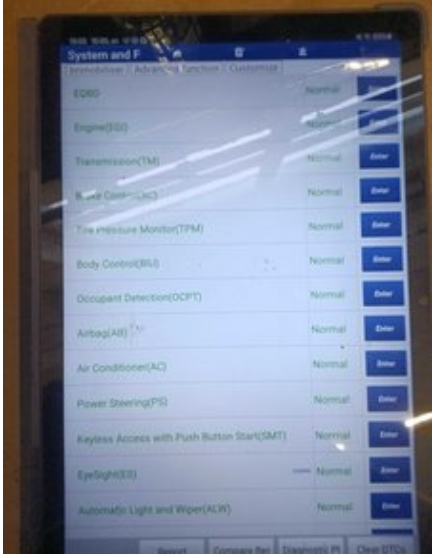

Exterior

1. Front: Front Bumper - Condition and Alignment



2. Front: Hood - Visual Damage



3. Rear: Tow Hitch (Attachment, Removal Mechanism, External Light Connector, Connector Thickness)




Mechanical

1. OTHER: Engine Oil & Filter Change

2. SUSPENSION: Suspension Lower Arm Both



3. SUSPENSION: Anti-Roll Bar

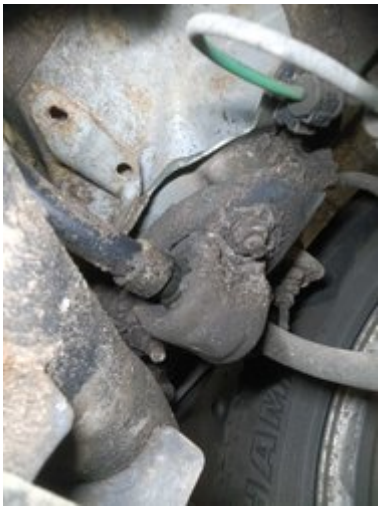


Other

1. Diagnostic Photo





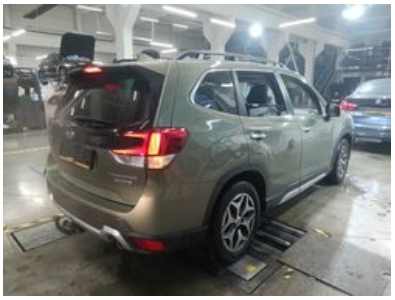



2. Brake Test Line Results





3. Air-Conditioning Measurement



4. Add Photo of Front Interior



Preparation and repair report of
2021 SUBARU FORESTER Comfort

Summary of work performed in Longo Preparation center

During the preparation process, the following works were performed

Body & Interior

- 1. Front Bumper Repair

Mechanical repairs

- 1. Anti-Roll Bar
- 2. Clean Socket
- 3. Engine Oil & Filter Change

Cleaning & polishing

- 1. Body wet wash
- 2. Full interior deep clean using only hypoallergenic cleaning products
- 3. Post cleaning body polish

Spare parts used during preparation

1. Oil Filter (OP595/4)
2. Quartz Ineo Xtra EC6 0W20 208L 4.2L
3. Oil Pan Gasket (705.070)

Disclaimer
This report has been generated automatically using the information available in our systems and may not be fully comprehensive or complete. Automated translation technology was used in its preparation, and as a result, minor inaccuracies may occur. If you have any questions or if any part of the report is unclear, please do not hesitate to contact our sales team. They will be happy to assist you.

Additional information about

2021 SUBARU FORESTER Comfort

Additional pictures






YOKOHAMA
GEOLANDAR A/T


longo


longo



longo




SUBARU
BOXER



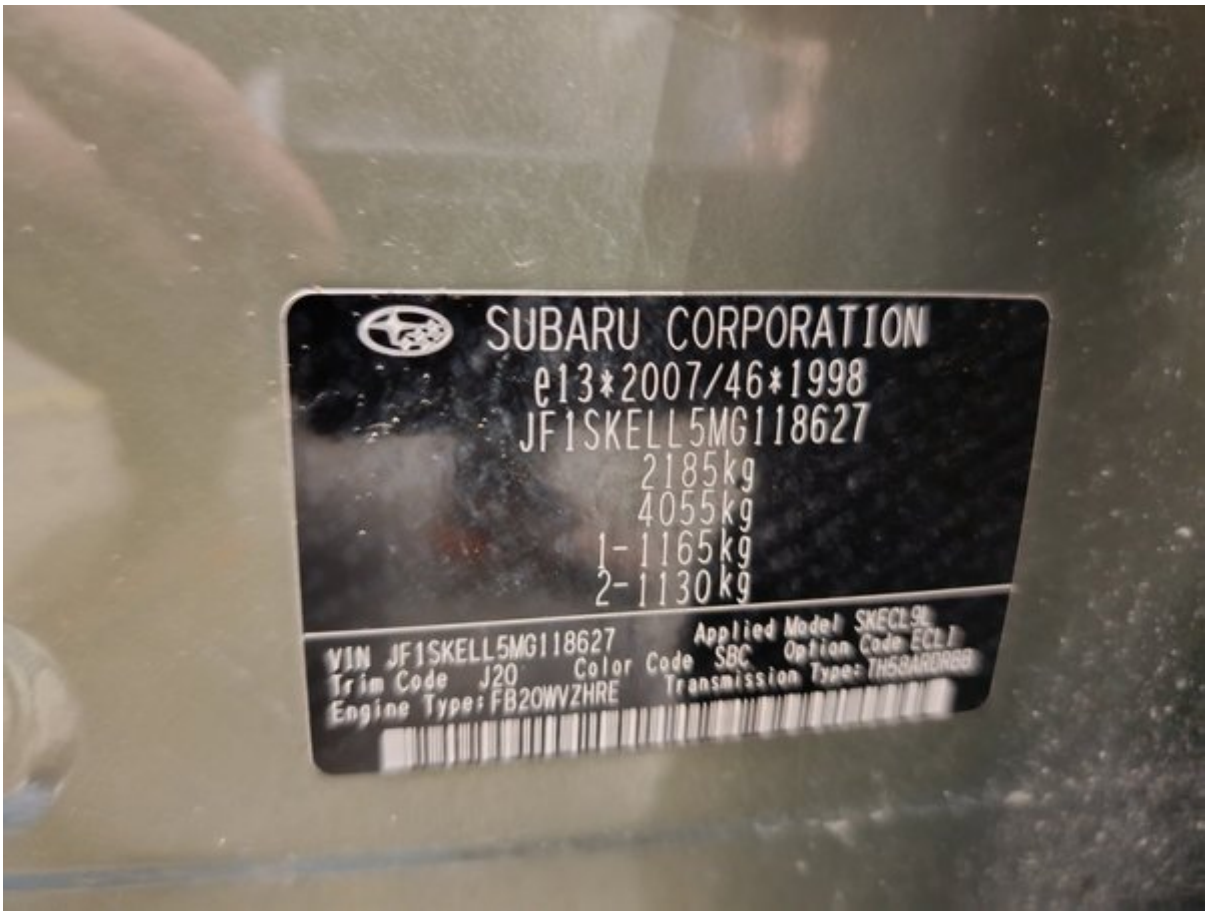



SUBARU CORPORATION
e13*2007/46*1998
JF1SKELL5MG118627
2185kg
4055kg
1-1165kg
2-1130kg
VIN JF1SKELL5MG118627
Trim Code J20
Engine Type:FB20WVZHRE
Color Code
Applied Model SKECL9L
Option Code ECLJ
Transmission Type:TH5BARDRBB


l/100km
Pull and hold "VSET" Switch For Menu
READY
x1000r/min
km/h
314.6
148488km


TotalEnergies
Next Oil Change
baltics.totalenergies.com


Handleiding
FORESTER
e-BOXER
SUBARU

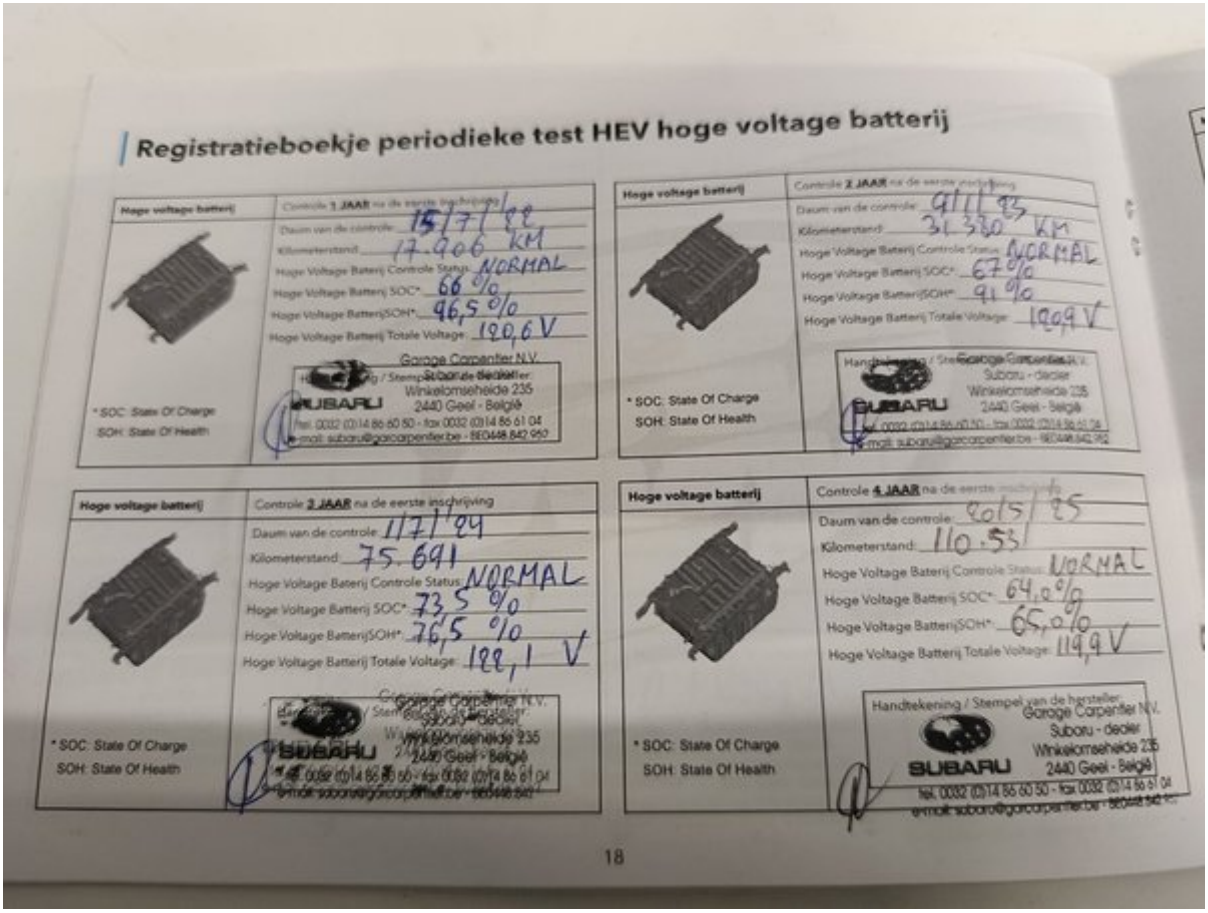

Registratieboekje periodieke test HEV hoge voltage batterij

Hoge voltage batterij — Controle 1 JAAR na de eerste inschrijving
Daum van de controle: 15/7/22
Kilometerstand: 17.906 KM
Hoge Voltage Baterij Controle Status: NORMAL
Hoge Voltage Batterij SOC*: 66 %
Hoge Voltage BatterijSOH*: 96,5 %
Hoge Voltage Batterij Totale Voltage: 120,6 V
Garage Carpenter N.V.
Subaru - dealer
Winkelomseheide 235
2440 Geel - België
tel. 0032 (0)14 86 60 50 - fax 0032 (0)14 86 61 04
e-mail: subaru@garcarpenter.be - BE0448.842.950
* SOC: State Of Charge
SOH: State Of Health

Hoge voltage batterij — Controle 2 JAAR na de eerste inschrijving
Daum van de controle: 9/11/23
Kilometerstand: 31.330 KM
Hoge Voltage Baterij Controle Status: NORMAL
Hoge Voltage Batterij SOC*: 67 %
Hoge Voltage BatterijSOH*: 91 %
Hoge Voltage Batterij Totale Voltage: 120,9 V
Handtekening / Stempel van de hersteller:
Garage Carpenter N.V.
Subaru - dealer
Winkelomseheide 235
2440 Geel - België
* SOC: State Of Charge
SOH: State Of Health

Hoge voltage batterij — Controle 3 JAAR na de eerste inschrijving
Daum van de controle: 11/7/24
Kilometerstand: 75.691
Hoge Voltage Baterij Controle Status: NORMAL
Hoge Voltage Batterij SOC*: 73,5 %
Hoge Voltage BatterijSOH*: 76,5 %
Hoge Voltage Batterij Totale Voltage: 122,1 V
Garage Carpenter N.V.
Subaru - dealer
Winkelomseheide 235
2440 Geel - België
* SOC: State Of Charge
SOH: State Of Health

Hoge voltage batterij — Controle 4 JAAR na de eerste inschrijving
Daum van de controle: 8/5/25
Kilometerstand: 110.531
Hoge Voltage Baterij Controle Status: NORMAL
Hoge Voltage Batterij SOC*: 64,0 %
Hoge Voltage BatterijSOH*: 65,0 %
Hoge Voltage Batterij Totale Voltage: 119,9 V
Handtekening / Stempel van de hersteller:
Garage Carpenter N.V.
Subaru - dealer
Winkelomseheide 235
2440 Geel - België
tel. 0032 (0)14 86 60 50 - fax 0032 (0)14 86 61 04
* SOC: State Of Charge
SOH: State Of Health

18





Longo 150-point checklist

Every vehicle is carefully examined according to Longo's comprehensive 150-point checklist, ensuring a thorough assessment mechanical condition. Depending on the factors such as condition, mileage, and specifications, additional checks may be includ may be omitted.

Vehicle Identity & History		
Vehicle identification number (VIN) verified	Registration number confirmed	Mileage verified
Year of manufacture confirmed	First registration date confirmed	Service history checked
Last service date and mileage recorded	Next service due date recorded	Previous accident damage check performed
Manufacturer recall status checked	Vehicle documents verified	Number of keys checked
Exterior Condition		
Front bumper inspected	Rear bumper inspected	Bonnet/hood inspected
Roof inspected	Left side panels inspected	Right side panels inspected
All doors inspected	Boot/trunk inspected	Fuel filler cover inspected
Tow bar (if fitted) inspected	Number plate condition confirmed	Paintwork overall checked
Rust or corrosion checked	Gaps between panels checked	Windscreen inspected
Rear window inspected	Side windows inspected	Sunroof/panoramic roof inspected
Interior Condition		
Driver's seat condition checked	Passenger seats checked	Rear seats checked
Seat adjustment mechanisms tested	Seat heating/cooling tested (if fitted)	Seatbelts checked
Carpets inspected	Floor mats inspected	Headlining inspected
Interior trims inspected	Dashboard inspected	Door trims inspected
Armrest inspected	Parcel shelf inspected	Luggage area condition checked
Luggage area carpets checked	Luggage area lighting tested	Spare wheel / repair kit checked
Lights, Mirrors & Glass		
Front headlights tested	High beam tested	Fog lights tested
Daytime running lights tested	Rear lights tested	Brake lights tested
Reverse lights tested	Indicators tested	Number plate lights tested
Side markers/reflex reflectors checked	Interior lights tested	Dashboard warning lights checked
Sun visors inspected	Interior mirror inspected	Exterior mirrors inspected
Electric mirror adjustment tested		
Comfort & Electronics		
Air conditioning tested	Heating system tested	Ventilation system tested
Window heating tested (front/rear)	Power windows tested	Central locking tested
Remote key tested	Child lock tested	Infotainment screen tested
Radio tested	Navigation tested (if fitted)	Bluetooth connection tested
USB/12V sockets tested	Parking sensors tested	Rear view camera tested
Parking assistance systems tested	Cruise control tested	Steering wheel buttons tested
Horn tested	Electronic driver aids checked (lane assist, etc., if fitted)	
Safety Equipment		
Airbags checked via system	Passenger airbag switch checked	ABS warning light checked
ESC/traction control checked	Tyre pressure monitoring system tested	Fire extinguisher/first aid kit present (if supplied)
Engine Bay & Fluids		
Engine starts normally	Engine idles smoothly	Unusual engine noises checked
Engine mounts checked	Drive belts checked	Timing belt/chain condition checked
Battery condition tested	Battery charging tested	Alternator performance tested
Fluid leaks checked	Engine oil level checked	Engine oil quality checked
Coolant level checked	Coolant quality checked	Brake fluid level checked
Brake fluid quality tested	Power steering fluid level checked	Power steering fluid quality checked
Windscreen washer fluid filled	Fuel system checked for leaks	
Braking System		
Front brake discs checked	Rear brake discs checked	Brake pads checked
Brake hoses checked	Brake lines checked	Parking brake tested
Brake pedal response tested	ABS function confirmed	
Steering & Suspension		
Steering wheel alignment checked	Steering response tested	No excessive steering play confirmed
Power steering assistance tested	Front suspension inspected	Rear suspension inspected
Shock absorbers inspected	Springs inspected	Ball joints inspected
Wheel bearings checked		
Wheels & Tyres		
Front tyres tread depth measured	Rear tyres tread depth measured	Tyre wear pattern checked
Tyre sidewalls inspected	Tyre pressures checked	Spare tyre condition checked
Alloy wheels checked for damage	Wheel nuts/bolts secure	Locking wheel nut present
Additional tyre set inspected (if included)		
Exhaust & Fuel System		
Exhaust condition checked	Exhaust leaks checked	Catalytic converter present
Diesel particulate filter present (if fitted)	Fuel tank condition checked	Fuel lines inspected
Fuel filler cap tested		
Road Test & Driving Performance		
Smooth acceleration confirmed	Smooth gear shifting confirmed	Clutch operation tested
Braking performance tested	Driving stability confirmed	